



NOTICE TO BUYER: SELLER-PROCURED INSPECTION REPORT

The following notice is given with respect to the Purchase and Sale Agreement dated _____
between _____ (“Buyer”)
and James and Amanda Records (“Seller”)
concerning 8836 NE 138th St. Kirkland WA 98034 (“the Property”).

Seller has given or is giving Buyer a copy of an Inspection Report dated 09/08/2017 concerning the Property. The Inspection Report is intended to be a part of any Seller Disclosure Statement (NWMLS Form 17) that is provided in this transaction, whether or not the two documents are attached to each other. The Inspection Report was procured by Seller and is provided for informational and disclosure purposes only. It is not intended to constitute a warranty, either express or implied, about the condition of the Property. Buyer is advised to procure their own inspection from a professional inspector chosen by Buyer or hire the inspector that prepared the Inspection Report. Buyer has the opportunity to inspect the Property to Buyer’s satisfaction.

Seller DATE

Seller DATE

Buyer’s Acknowledgment of Receipt

The undersigned Buyer acknowledges receipt of the foregoing Notice and the above-referenced Inspection Report.

Buyer DATE

Buyer DATE

James and Amanda Records
8836 NE 138th St.
Kirkland WA 98034

Per the Seller on 9/11/17, the following items have been corrected:

6.10 WIRING

- Splices in cable made outside of a junction box were observed in the attic. This is a fire hazard. The splices should be made inside an approved box with a cover.
- The wires are not protected where they enter the disposal. This could damage the wires or cause a ground fault. The cord should be clamped and covered in accordance with industry standards.

6.11 RECEPTACLES

- The polarity is reversed in receptacles in the dining area and at the exterior deck. Reversed polarity means that the hot and neutral wires are reversed at the back of the receptacle. This defect is a shock hazard and can damage some electronic equipment. All receptacles exhibiting reversed polarity should be rewired.
- There are numerous loose receptacles throughout the home. This is a potential shock and a fire hazard. All loose receptacles should be repaired as necessary.
- Cover plates are missing from receptacles in the closet under the stairs and adjacent to the water heating unit. This is a shock and fire hazard. The installation of cover plates on all receptacles is recommended.

6.15 SWITCHES

- The cover plate is missing from the wall switch in the closet under the stairs. This is a shock and fire hazard.
- The installation of a cover plate is recommended.

6.12 GFCI RECEPTACLES

- The installation of additional GFCI protection in the exterior receptacles is recommended.
- The installation of just one GFCI outlet for protection of each circuit is recommended.

Per the seller, the following items from the inspection summary will be completed before closing:

6.8 SERVICE PANEL

- Several of the screws that secure the panel cover to the panel box are stripped. This is a potential hazard.
- Properly fitted screws with blunt ends should be installed.

10.2 Bathtub

- The overflow drain for the bathtub is leaking. This can cause damage to the framing and/or finished surfaces.
- Repairs should be performed on the tub before it is used.

10.6 Sink

- The drain stop is not operational. It should be repaired or replaced.

10.4 Flooring material

- The grout is cracked at the intersection between the tub/shower and the floor. This can lead to water damage to the flooring and substrate. Caulking this area with flexible grout is recommended.

10.17 Toilet

- The toilet is loose where it mounts to the floor. A loose toilet will eventually start to leak and will damage the flooring material.. The most reliable fix for this condition is to remove the toilet and install a new wax seal. The toilet should then be securely mounted to the floor.

Per the seller, any additional items from the inspection summary will be considered as part of the Buyer's offer, if written in the Purchase and Sale Agreement.

September 9, 2017

Mr. & Mrs. Jim & Amanda Records
8836 NE 138th St.
Kirkland, WA.

Re: 8836 NE 138th St.
Kirkland, WA.

Dear Jim & Amanda;

At your request, a visual inspection of the above referenced property was conducted on 09/08/2017. We have inspected the major structural components, plumbing, heating and electrical systems for signs of significant non-performance, excessive or unusual wear and general state of repair.

Clark Inspections inspectors, inspect all homes and buildings according to the stringent professional standards and code of ethics set forth by the American Society of Home Inspectors (ASHI). The ASHI standards are designed to identify and disclose to the client certain conditions of the major systems as these conditions exist at the time of the inspection. These standards are designed for a visual inspection of the readily accessible areas of the included system. A copy of these standards will be provided upon request or can be obtained by calling the ASHI automatic "Information-On-Demand" phone number at 1-800-743-2744

Home or building inspections performed under these standards should not be construed as a compliance inspection of any governmental or non-governmental codes or regulations. Inspections performed under these standards are essentially visual; are based on the experience and opinion of the inspector; and are not intended to be technically exhaustive. Inspections performed under these standards are not meant to be warranties nor guarantees of adequacy of performance of the structures, systems, or their component parts.

This inspection does not include an inspection for construction or other materials which might be hazardous to your health. It is possible that such materials may be present and not noted in this report.

This inspection does not include the testing or inspection of security systems, intercoms, communication systems, video, or sprinkler systems. These items are highly specialized and individualistic. Clark Inspections recommends that you have the seller and/or real estate agent/broker demonstrate the operation and serviceability of these systems to you prior to the closing of the sale.

Mechanical equipment is inspected for operability only and may contain undisclosed defects which may significantly impair it's usefulness.

Defects are examined and a determination is made on how a particular defect will affect interrelated building parts and whether immediate repairs are required.

Since all buildings have defects, it is important to know and understand what they are and how they affect the house and property. Some of the defects mentioned in this report may be quite typical, and found in other homes of comparable age and price. Some however, may not. We make our best attempt to distinguish this for you in both verbal and written reports.

REPORT SUMMARY

The comments in this report are categorized. General information is given on the type of materials and construction methods. Specific information is given pertaining to the condition of a component and applicable repair and maintenance work that may be required.

Statements, representations, or conclusions offered by the inspector are the considered opinion of the inspector, but these statements, representations, or conclusions do not constitute an expressed or implied warranty of any kind. Neither the inspector nor Clark Inspections Inc. shall be liable for any direct, special, incidental, or consequential damages under an circumstances whatsoever, whether arising in tort, negligence, or contract, nor for any loss, claim, expense, or damage caused by or arising out of his or its inspection of a structure, nor will the inspector or Clark Inspections Inc. indemnify or hold others harmless for any loss, claim, expense, or damage arising out of his or its inspection of a structure.

ACTION ITEMS, SIGNIFICANT DEFECTS AND/OR HEALTH AND SAFETY ISSUES

Non-operational (Action) items, safety or health issues, areas with limited viewing for proper inspection and components that do not serve their intended function (Significant Defects) are listed here. These items will likely require further evaluation and repair by licensed tradespeople.

Please Read entire report

BUILDING SITE

2.5 WALKWAY

The walkway has cracked and settled differentially. This was probably caused by inadequate preparation of the soil prior to the placement of the concrete. This condition can be repaired by pressure grouting the sunken portion of the walkway or by removing and replacing it. The walkway remains functional despite this condition. However, the raised edges of the concrete can be a trip hazard for some people. Grinding down the raised edges of the concrete will mitigate the hazard. Repairs should be made as necessary.



Cracks were observed in the concrete surface of the walkway. Minor cracks can be sealed to minimize moisture entry and further settlement of the concrete.



The gap separating the concrete and asphalt sections are a trip hazard. Replacement with mortar is

recommended.

ELECTRICAL SYSTEM

6.8 SERVICE PANEL

Several of the screws that secure the panel cover to the panel box are stripped. This is a potential hazard. Properly fitted screws with blunt ends should be installed.

6.10 WIRING

Splices in cable made outside of a junction box were observed in the attic. This is a fire hazard. The splices should be made inside an approved box with a cover.



The wires are not protected where they enter the disposal. This could damage the wires or cause a ground fault. The cord should be clamped and covered in accordance with industry standards.



6.11 RECEPTACLES

The polarity is reversed in receptacles in the dining area and at the exterior deck. Reversed polarity means that the hot and neutral wires are reversed at the back of the receptacle. This defect is a shock hazard and can damage some electronic equipment. All receptacles exhibiting reversed polarity should be rewired.

There are numerous loose receptacles throughout the home. This is a potential shock and a fire hazard. All loose receptacles should be repaired as necessary.



Cover plates are missing from receptacles in the closet under the stairs and adjacent to the water heating unit. This is a shock and fire hazard. The installation of cover plates on all receptacles is recommended.



6.12 GFCI RECEPTACLES

The installation of additional GFCI protection in the exterior receptacles is recommended.

The installation of just one GFCI outlet for protection of each circuit is recommended.

6.15 SWITCHES

The cover plate is missing from the wall switch in the closet under the stairs. This is a shock and fire hazard. The installation of a cover plate is recommended.

HEATING SYSTEM

FORCED AIR HEATING SYSTEM

7.5 BURNERS

The burners are clogged with debris. This reduces the burner efficiency and produces carbon monoxide. Cleaning the burners is recommended.

7.8 VENT

The furnace vent connector is too close to a combustible material. This is a hazard. A minimum clearance of 6" is required between the single wall vent connector and the combustible material. The double wall type B vent requires only 1" of clearance. Repairs are recommended.



7.10 AIR FILTER

The air filter is clogged with dust. This reduces air flow and furnace efficiency. Removal and replacement of the air filter is recommended. Pleated style air filters are recommended as they offer better filtration of dust than the coarser hogs hair or fiberglass filters.

7.13 GENERAL COMMENTS

The furnace's response to the thermostat's call for heat was short cycled. The furnace is in need of repair. The services of a qualified gas furnace technician should be retained to evaluate and repair the furnace.

The furnace is 28 years old and is nearing the end of its service life. The need for furnace replacement should be anticipated.

KITCHEN

9.8 AIR GAP

The dishwasher drain lacks an air gap. The dishwasher will function without one, but there is a risk of contamination of the inside of the dishwasher by waste water. The installation of an air gap is recommended.



BATHROOMS

HALLWAY BATHROOM

10.2 BATHTUB

The overflow drain for the bathtub is leaking. This can cause damage to the framing and/or finished surfaces. Repairs should be performed before the tub is used.

10.11 VENTILATION

The exhaust fan is very noisy and is not likely to be used in its present condition. We recommend that it be serviced or replaced to restore quiet operation.

LOWER FLOOR BATHROOM

10.17 TOILET

The toilet is loose where it mounts to the floor. A loose toilet will eventually start to leak and will damage the flooring material.. The most reliable fix for this condition is to remove the toilet and install a new wax seal. The toilet should then be securely mounted to the floor.

INTERIOR

13.3 STAIRS

There is no handrail in the stairwell. This is a safety hazard. The installation of a graspable handrail that conforms to present industry standards is recommended.



13.7 WINDOWS

There is condensation or mineral deposits between the panes of glass in one of the insulated glass window panes. This indicates a failed seal. The glass assembly should be replaced, which is the only method for correcting this deficiency.



13.8 SMOKE DETECTORS

Smoke detectors are examined for location only. They are not tested. Smoke detector batteries should be replaced when you move in and every year thereafter. Once batteries have been replaced, the smoke detectors should be tested for proper operation.

FOR MAXIMUM PROTECTION: Use both Ionization and Photoelectric smoke alarms in every bedroom/hallway on every level of your home.

The installation of at least one carbon monoxide monitor for each floor is recommended. The best place to install the monitor is in an open area near the gas appliance.

MAINTENANCE ITEMS AND/OR COMPONENTS NEARING THE END OF THEIR SERVICE LIFE

Any item that in the opinion of the inspector is nearing the end of its normal service life and/or conditions that need repair, maintenance and/or upgrades, but have not affected basic functions are listed herein.

BUILDING SITE

2.4 DRIVEWAY

Portions of the asphalt driveway and parking areas are deteriorated. The deteriorated areas are not adversely affecting the function of the driveway, therefore patching or resurfacing is optional.



BUILDING EXTERIOR

3.1 PRIMARY EXTERIOR WALL CLADDING

Sections of siding adjacent the deck are missing. Consideration should be given to installing flashing and/or caulk to prevent moisture or pest entry into this area.



3.2 PEST CONTROL

Untreated wood in direct contact with concrete was observed along the entry stoop. Untreated wood should be raised 1-2" above the concrete. Treating the wood with a preservative sometimes will prevent wood destroy organism damage.



3.3 SOFFITS AND OVERHANGS

There are large gaps over 1/4" in size adjacent the soffit vent blocks. These gaps allow insects and rodents to enter the attic. Covering the gaps with screening, a strip of wood and/or caulking is recommended.




3.6 DECK

The deck structure lacks lateral bracing. The installation of a diagonal brace underneath the deck is recommended.



There is no flashing at the intersection between the deck and house. This will allow water to enter behind the siding. The installation of flashing in this area is recommended.

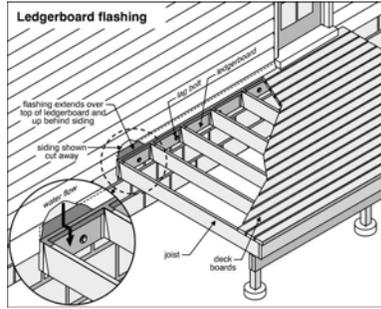

ROOF

4.3 CHIMNEYS

The chimney crown is cracked and deteriorated. The mortar chimney crown prevents water from entering and damaging the masonry. Repairing or replacing the chimney crown will extend the service life of the chimney.



The top of the masonry chimney does not have spark arrestor/rain caps. The installation of a spark arrestor/rain cap for each flue is recommended as a safety upgrade and to prevent moisture damage to the inside of the chimney and fireplace. An additional benefit of a rain cap is that it will keep birds and rodents from entering the house when the damper is left open.

4.4 GAS APPLIANCE VENTS

The gas appliance vent is corroded above the roof line. Cleaning and painting the vent will prolong its service life.



ATTIC

5.3 MECHANICAL VENTILATION SYSTEMS

Flexible plastic duct is used to direct air from the vent fan to the exterior. This type of material is unreliable. Replacing the plastic duct with 4" smooth-wall sheet metal duct is recommended.



BATHROOMS

HALLWAY BATHROOM

10.3 TUB WALLS

Penetrating grout and tile sealers are recommended for preserving the condition of the grout. Grout sealer keeps stains from seeping into and setting in grout. Also, mold and mildew are kept from growing into the grout and the grout stays cleaner for a longer period of time and it will decrease the amount of maintenance that is required to keep it looking good and well maintained. For maximum protection, the sealer should be reapplied at least once.

10.4 FLOORING MATERIAL

The grout is cracked at the intersection between the tub/shower and floor. This can lead to water damage to the flooring and substrate. Caulking this area with a flexible grout is recommended.

10.6 SINK

The drain stop is not operational. It should be repaired or replaced.

LOWER FLOOR BATHROOM

10.20 FAUCET FIXTURES

The shower faucet fixture is dripping. This wastes water and will erode the surface of the sink. The leaking faucet should be repaired or replaced.



LAUNDRY ROOM

11.1 APPLIANCES

Upgrading the washer connections to high pressure (steel braided) lines is recommended.

PLUMBING SYSTEM

12.5 WATER PRESSURE

The water pressure at 90 PSI is excessive. The normal range is 40-80 PSI. High water pressure can result in leaking valves, detached supply tubes, water hammer and is hard on solenoid valves. Consideration should be given to the installation of a pressure reduction valve.

INTERIOR

13.5 DOORS

Some of the doors are missing their door stops. This condition will lead to damage of the wall surfaces. Door

stops should be installed where necessary.

13.6 CLOSET DOORS

Hardware is missing from the closet door. Installation of the missing hardware is recommended.

FIREPLACES, WOOD STOVES AND SPACE HEATERS

14.3 WOOD STOVE INSERT

The visible portions of the wood stove insert are properly installed and are in good condition. The condition of the fireplace in which the insert is placed was not visible for inspection and its condition was not determined.

The smoke pipe should extend from the top of the insert, through the smoke chamber and into the flue. This portion of the installation is not visible for inspection. You should have a chimney sweep examine this component when the chimney flue is cleaned.

INSULATION

16.1 ATTIC INSULATION

The attic is insulated with blown in cellulose insulation. The approximate R value of this insulation is 9. This provides only minimal resistance to heat transfer. Adding additional insulation to achieve an R value of 30 is recommended to reduce heat loss through the ceilings.

16.2 WALL INSULATION

The exterior walls are not insulated. The installation of wall insulation can be accomplished by boring 2" holes in the drywall or plaster and injecting cellulose into the wall cavity.

Several of these items will likely require further evaluation and repair by licensed tradespeople. Other minor items are also noted in the report and could be mentioned but none of them affect the habitability of the house.

Thank you for selecting our firm to do your home inspection. If you have any questions regarding the inspection report or the home, please feel free to call us.

Sincerely,

Terry Clark
206-244-5339
Clark Inspections Inc.

Confidential Inspection Report

**8836 NE 138th St.
Kirkland, WA 98034**

September 8, 2017

Prepared for: Jim & Amanda Records

This report is the exclusive property of the inspection company and the client whose name appears herewith and its use by any unauthorized persons is prohibited.

Inspection Table of Contents

GENERAL INFORMATION	4
BUILDING SITE	7
BUILDING EXTERIOR	9
ROOF	11
ATTIC	12
ELECTRICAL SYSTEM	13
HEATING SYSTEM	15
ON-DEMAND WATER HEATER	16
KITCHEN	17
BATHROOMS	18
LAUNDRY ROOM	20
PLUMBING SYSTEM	21
INTERIOR	22
FIREPLACES, WOOD STOVES AND SPACE HEATERS	23
ENVIRONMENTAL ISSUES	24
INSULATION	26
STRUCTURE	26
BASEMENT	27
OUT BUILDING	28

9/9/2017

**Mr. & Mrs. Jim & Amanda Records
8836 NE 138th St.
Kirkland,WA**

Dear Jim & Amanda,

Thank you for inviting to inspect for you. We appreciate having the opportunity to perform this home inspection and are happy to help with all of your inspection needs. Enclosed is our report for the property located at;

8836 NE 138th St.

We have inspected the major structural components, plumbing, heating, and electrical systems for signs of significant non-performance, excessive or unusual wear and general state of repair.

This inspection report is designed to be easy to understand. Please take time to review it carefully. If you have any questions regarding this inspection, or receive information from another building inspection professional, contractor, or tradesperson, that is in conflict with this report, or any major defect in your home or building that was not described in your verbal or written reports, please call our office immediately. We are happy to answer any questions you may have.

Thank you for the opportunity to be of service.

Sincerely,

Terry Clark

GENERAL INFORMATION

CLIENT & SITE INFORMATION:

1.1 DATE OF INSPECTION:

9/8/2017.

1.2 INSPECTOR'S NAME:

Terry Clark.

1.3 CLIENT NAME:

Mr. & Mrs. Jim & Amanda Records.

1.4 MAILING ADDRESS:

8836 NE 138th St.
Kirkland WA.

1.5 CLIENT E-MAIL ADDRESS

[james.records@gmail.com.](mailto:james.records@gmail.com)

1.6 ADDRESS OF PROPERTY INSPECTED

8836 NE 138th St.
Kirkland WA.



South elevation

CLIMATIC CONDITIONS:

1.7 WEATHER:

Overcast.

1.8 APPROXIMATE OUTSIDE TEMPERATURE:

72 degrees.

BUILDING CHARACTERISTICS:

1.9 MAIN ENTRY FACES:

South.

1.10 ESTIMATED AGE OF BUILDING:

The building is approximately 50 years old.

1.11 BUILDING TYPE:

Two story, split-entry, single family residence.

1.12 SPACE BELOW GRADE:

Slab on grade, Ground floor living area.

SCOPE, PURPOSE AND LIMITATIONS

1.13 RESIDENTIAL

The purpose of this inspection was to discover and evaluate major defects, deficiencies and deferred maintenance found in the main components of the house and in the building site immediately around the building inspected. A major defect or deficiency is a system or component that in the judgment of the inspector, would cost in excess of \$500.00 to repair or replace, is not performing it's intended function, or adversely affects the habitability of the dwelling or building. Defects are examined and a determination is made on how a particular defect will affect interrelated building parts and whether immediate repairs are required.

The major components in this report are categorized. General information is given on the type of materials and construction methods. Specific information is given pertaining to the condition of a component and applicable repair and maintenance work that may be required.

Since all buildings have defects, it is important to know and understand what they are and how they affect the house and property. Some of the defects mentioned in this report may be quite typical, and found in other homes of comparable age and price. Some, however, may not. We make our best attempt to distinguish this for you in both the verbal and written reports.

Clark Inspections inspectors inspect all homes and buildings according to the stringent professional standards and code of ethics set forth by the American Society of Home Inspectors (ASHI). The ASHI standards are designed to identify and disclose to the client certain conditions of the major systems as these conditions exist at the time of the inspection. These standards are designed for a visual inspection of the readily accessible areas of the included system. A copy of these standards will be provided upon request or can be obtained by calling the ASHI automatic "Information-On-Demand" phone number at 1-800-743-2744.

Home or building inspections performed under these standards should not be construed as a compliance inspection of any governmental or non-governmental codes or regulations. Inspections performed under these standards are essentially visual; are based on the experience and opinion of the inspector; and are not intended to be technically exhaustive. Inspections performed under these standards are not meant to be warranties nor guarantees of adequacy of performance of the structures, systems, or their component parts.

This inspection does not include an inspection for construction or other materials which might be hazardous to your health. It is possible that such materials may be present and not noted in this report.

This inspection does not include the testing or inspection of security systems, intercoms, communication systems, video, or sprinkler systems. These items are highly specialized and individualistic. Clark Inspections recommends that you have the seller and/or real estate agent/broker demonstrate the operation and serviceability of these systems to you prior to the closing of the sale.

Mechanical equipment is inspected for operability only and may contain undisclosed defects which may significantly impair it's usefulness.

Statements, representations, or conclusions offered by the inspector and/or by Clark Inspections are based solely upon a visual examination of the exposed areas of the structure inspected. Areas of the structure which are not exposed to the naked eye cannot be inspected, and no conclusions, representations, or statements offered by the inspector are intended to relate to areas not exposed to view. Hidden defects could have a significant impact on the visually based conclusions, statements, and representations made by the inspector.

Statements, representations, or conclusions offered by the inspector are the considered opinion of the inspector, but these statements, representations, or conclusions do not constitute an expressed or implied warranty of any kind. Neither the

inspector nor Clark Inspections shall be liable for any direct, special, incidental, or consequential damages under any circumstances whatsoever, whether arising in tort, negligence, or contract, nor for any loss, claim, expense, or damage caused by or arising out of his or its inspection of a structure, nor will the inspector or Clark Inspections indemnify or hold others harmless for any loss, claim, expense, or damage arising out of his or its inspection of a structure.

If you receive information from another building inspection professional, contractor or trades person that is in conflict with ours, or if you discover a major defect in your home or building that was not described in your verbal or written reports, please call us immediately.

NOTE: WAC 16-228-2045 requires that a diagram identifying the location of wood destroying organisms be prepared for wood destroying organism inspection reports. A copy of this diagram will be made available to you upon request.

GENERAL COMMENTS

1.14 RECOMMENDATIONS

Certain building designs and/or building site topography may not qualify for earthquake insurance. Each company has its own underwriting policies. You should check with your insurance agent to determine whether or not your insurance company will write an earthquake policy on this property.

There may be information pertinent to this property which is a matter of public record. A search of public records is not within the scope of this inspection. We recommend you review all applicable public records that pertain to this property.

We make no representations as to the extent of presence of code violations, nor do we warrant the legal use of this building. This information can be obtained from the local building and/or zoning department.

1.15 BUILDING CODES

A code is a system of rules and procedures, the purpose of which is to provide minimum standards to safeguard life, health, and property by regulating certain aspects of building design, construction, use and maintenance. Local codes are usually based on model codes. A community may amend or adopt only parts of a model code. These local codes may not always be the latest version of the model code. Code enforcement is nearly always a local government responsibility and is handled in several ways depending on the type of code and community involved. All model codes and most local codes, grant the code compliance inspector or building official the right to interpret the code to suit special situations. This makes the building official the final authority, not the code book.

Answering the question "Does this meet code?" depends on the building's age, when remodels and upgrades were performed and which codes if any are enforced. This information may not be readily available to the home inspector. Private inspectors usually can determine if an item complies with applicable national model codes, if they know when the work was done and what code was applicable at that time. Local municipalities adopt and enforce national model codes at their discretion. Private building inspectors are typically not permitted to perform code compliance inspections. Code compliance inspections are typically performed by the local code enforcement official. Private building inspectors check to determine whether or not an item performs its intended function or is in need of repair.

Code enforcement usually is a local question and subject to the interpretation by the building code enforcement official. Most communities do not require an existing building to meet "code" prior to sale.

Specific code questions can be referred to the local building official. however, you must realize that if city inspectors check a building, they have the authority to require corrections of any violation. Private building inspectors act solely in an advisory capacity. Their objective reports are a tremendous benefit to anyone purchasing or selling real estate.

BUILDING SITE

The evaluation of the building site and grounds includes grading, roof water and surface drainage systems, fencing, gates, walkways, curbs, driveways, patios, and retaining walls connected to or directly adjacent the structure. These items are visually examined for proper function, excessive or unusual wear and general state of repair. Components or portions of components may not be visible because of soil, vegetation, storage of personal effects and/or the nature of construction. In such cases these items are considered inaccessible and are not inspected. Lawn irrigation systems, fountains, and low voltage decorative garden lights are not included in this inspection.

The following components were inspected:

2.1 ROOF WATER DRAIN SYSTEM

A below grade roof water drain system is used to divert rain water discharged from the downspouts away from the foundation wall. Below grade drain system designs vary and it is virtually impossible to evaluate the integrity of the system definitively, due to the fact that it is entirely underground. There is a high incidence of defects in these systems, due to the fact that historically, very few municipalities inspected or enforced design or quality standards.

Representative samples of the roof water drain system were tested by inserting a hose into the drain inlet and then letting it run for 10 minutes. There was no water back-up or overflow from the drain line inlets tested.

Defects in these drain systems are one of the most common causes of water or moisture problems in ground floor occupancies, basements and crawlspaces. Overflowing gutters and clogged downspouts and scuppers also frequently cause or exacerbate moisture or water entry problems in and around the building. If water entry or moisture problems are discovered, check the entire roof water drain system to insure that it is functioning properly.

Occasionally, (once a year) flushing out the drain lines with a garden hose will reduce the build-up of debris and sludge which could impede drainage. This type of maintenance is most effective if the end of the drain line terminates in open air or in a storm sewer. If the drain line terminates in a dry well or leach field, then the washing of debris down the line is not advisable. The debris may eventually clog the perforations in the line which allow the water to escape. This could render the drain system inoperative. It is always best to prevent debris from entering at the inlet.

2.2 GRADING

The building site is well drained. The finish grade slopes away from the house. No evidence of recent building site flooding, drainage or soil stability problems was observed.

2.3 VEGETATION

Dense shrubbery and trees planted too close to the building can damage siding and the roof overhang and interfere with drainage and air movement, thus promoting fungus growth and accelerated deterioration of exterior finishes and wood. Trees and shrubs in contact with the building also provide carpenter ants with a route into walls or attics. Trees and shrubs should be trimmed back, where required. When landscaping, trees and shrubs should be planted back away from the building so that they have room to grow.

2.4 DRIVEWAY

The driveway is paved with asphalt paving mix. The driveway is properly installed and is performing its intended function.

Portions of the asphalt driveway and parking areas are deteriorated. The deteriorated areas are not adversely affecting the function of the driveway, therefore patching or resurfacing is optional.



2.5 WALKWAY

The walkway has cracked and settled differentially. This was probably caused by inadequate preparation of the soil prior to the placement of the concrete. This condition can be repaired by pressure grouting the sunken portion of the walkway or by removing and replacing it. The walkway remains functional despite this condition. However, the raised edges of the concrete can be a trip hazard for some people. Grinding down the raised edges of the concrete will mitigate the hazard. Repairs should be made as necessary.

Many legal and public works departments have defined a trip hazard as an irregularity in a walking surface exceeding one inch (1") in height. All walking surfaces should maintain, free of a vertical surface change of 3/4" or more, in the interest of public and personal safety.

Cracks were observed in the concrete surface of the walkway. Minor cracks can be sealed to minimize moisture entry and further settlement of the concrete.

The gap separating the concrete and asphalt sections are a trip hazard. Replacement with mortar is recommended.



2.6 FENCES AND GATES

The fences are properly installed and are performing their intended function. The gates are properly installed and are performing their intended function.

BUILDING EXTERIOR

The evaluation of the building exterior includes the paint, stain, siding, windows, doors, flashing, trim, fascia, eaves, soffits, decks, porches balconies and railings. These items are visually examined for proper function, excessive or unusual wear and general state of repair. Components or portions of components may not be visible because of soil, vegetation, storage of personal effects and/or the nature of construction. In such cases these items are considered inaccessible and are not inspected.

The following components were inspected:

3.1 PRIMARY EXTERIOR WALL CLADDING

Cedar lap siding is used as an exterior wall cladding. Cedar is a wood that is durable and moderately resistant to decay. Maintaining the finish on the exposed siding will maximize its service life. The siding shows minor wear and deterioration typically caused when the exterior finish is not maintained. The deterioration is cosmetic and does not affect the function of the siding. No action is indicated.

Sections of siding adjacent the deck are missing. Consideration should be given to installing flashing and/or caulk to prevent moisture or pest entry into this area.



3.2 PEST CONTROL

Good building practice requires that foundation walls or pier footings supporting wood frame construction, extend at least 8" above the finish grade with at least a 6" clearance between the top of the soil and the bottom of the wood finish materials. Soil in direct contact with wood creates a hospitable environment for wood destroying organisms. These minimum standards should be maintained throughout the building exterior.

Untreated wood in direct contact with concrete was observed along the entry stoop. Untreated wood should be raised 1-2" above the concrete. Treating the wood with a preservative sometimes will prevent wood destroy organism damage.



3.3 SOFFITS AND OVERHANGS

The building has adequate overhangs. Overhangs protect the exterior walls, windows, doors, siding and exterior finish from the ravages of direct rain fall. Buildings with adequately sized overhangs will generally require less frequent exterior maintenance and are less likely to suffer from moisture related problems on the exterior walls.

There are large gaps over 1/4" in size adjacent the soffit vent blocks. These gaps allow insects and rodents to enter the attic. Covering the gaps with screening, a strip of wood and/or caulking is recommended.



3.4 GUTTERS AND DOWNSPOUTS

Roof runoff is collected and channeled into the downspouts by aluminum gutters fastened to the rafter tails. The gutters and downspouts are properly installed and are performing their intended function. Gutters should be cleaned regularly to prevent clogging and overflow. The downspouts are properly installed and are functioning as intended.

3.5 PAINT


The exterior paint and caulking is in good condition and is functioning as intended. Paint protects the wood from cupping, checking, warping and rot.

3.6 DECK

The deck is constructed from a combination of pressure treated fir and cedar. The deck is well constructed and is performing its intended function. Untreated wood (fir or cedar) will eventually rot. Annual treatments of the deck with a good quality wood preservative/water repellent will prevent cupping, checking and rotting of the wood and will maximize its service life. Do not use paint on exposed deck surfaces as it will peel and become difficult to maintain. Paint also traps moisture in the wood and will accelerate deterioration.

The deck structure lacks lateral bracing. The installation of a diagonal brace underneath the deck is recommended.

There is no flashing at the intersection between the deck and house. This will allow water to enter behind the siding. The installation of flashing in this area is recommended.

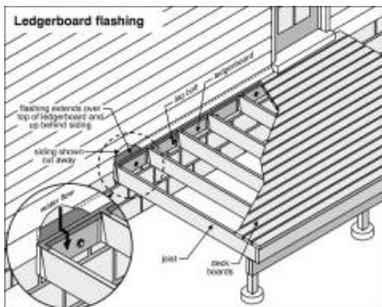

3.7 DECK RAILINGS

The deck railings are well constructed and are performing their intended function.

3.8 STAIRS

The deck stairs are properly constructed and are performing their intended function. The handrail is properly installed and is in serviceable condition.

3.9 PORCH

The front porch stoop has rotated towards the foundation. This is caused by settlement of the backfill under the stoop. This will not adversely affect the foundation.

3.10 EXTERIOR DOORS

The exterior doors are properly installed and are functioning as intended.

ROOF

We evaluate the condition of the roof system by inspecting the roofing material, skylights, flashings, penetrations and roof water drainage system for damage and deterioration. If we observe conditions such as damage, deterioration, defects in materials or workmanship, these items will be noted in your report. We may also offer opinions concerning repair and replacement. Opinions stated herein concerning the condition of the roof and roof service life are based on the condition of the roof system at the time of the inspection. These opinions do not constitute a warranty that the roof is, or will remain, free of leaks. All roof systems require annual maintenance and occasional repair. Failure to perform routine roof maintenance will usually result in leaks and accelerated deterioration of the roofing material. Our estimate of the life expectancy of the roof is based on the assumption that the roof will be properly repaired and maintained during that period.

The following components were inspected:

4.1 GENERAL INFORMATION

The roofing material is asphalt composition shingles. The slope or pitch of the roof is medium. The roof is approximately 5 years old.

4.2 INSPECTION METHOD

The inspection of this roof was conducted from the roof surface. The inspector walked on the roof and made a visual inspection of the components listed below.

4.3 CHIMNEYS

The visible portion of the masonry chimney is properly constructed and is in good condition.

The chimney crown is cracked and deteriorated. The mortar chimney crown prevents water from entering and damaging the masonry. Repairing or replacing the chimney crown will extend the service life of the chimney.

The top of the masonry chimney does not have spark arrestor/rain caps. The installation of a spark arrestor/rain cap for each flue is recommended as a safety upgrade and to prevent moisture damage to the inside of the chimney and fireplace. An additional benefit of a rain cap is that it will keep birds and rodents from entering the house when the damper is left open.



4.4 GAS APPLIANCE VENTS

The visible portion of the gas appliance type B vent is properly installed and in good condition.

The gas appliance vent is corroded above the roof line. Cleaning and painting the vent will prolong its service life.



4.5 FLASHINGS

Metal flashings are used to seal around chimneys, vents and roof to wall intersections. The flashings are properly installed and are performing their intended function.

4.6 GENERAL COMMENTS

The roofing material was properly installed and is in serviceable condition. With proper care and maintenance this roof should remain serviceable for up to 25 more years.

ATTIC

The attic contains the roof framing and serves as a raceway for components of the plumbing, electrical and mechanical systems. There are often heating ducts, bathroom vent ducts, electrical wiring, chimneys and gas appliance vents in the attic. We examine the visible portions of the various systems and components for proper function, excessive or unusual wear, general state of repair, roof leakage, attic venting and misguided improvements. When low clearance and/or deep insulation prohibit walking in an unfinished attic, inspection will be performed from the access opening only.

The following components were inspected:

5.1 ACCESS

The attic access is located in the hall closet.

5.2 VENTILATION

The attic is adequately vented.

5.3 MECHANICAL VENTILATION SYSTEMS

Flexible plastic duct is used to direct air from the vent fan to the exterior. This type of material is unreliable. Replacing the plastic duct with 4" smooth-wall sheet metal duct is recommended.



5.4 PEST CONTROL

There is evidence of rodent activity in the attic. The first step in eliminating rodents from the attic is to seal all possible entry points using wire mesh, caulking, wood, stainless steel wool, or aerosol foam. Careful work sealing cracks, holes and gaps over 1/4" in size will discourage further activity. Once this work is completed, snap traps baited with peanut butter should be installed and monitored. The absence of rodents in the traps typically means that the rodents have been excluded from the area.

ELECTRICAL SYSTEM

An electrical system consists of the service, distribution, wiring and convenience outlets (switches, lights and receptacles). Our examination of the electrical system includes the exposed and accessible wiring, service panels, subpanels, overcurrent protection devices, light fixtures and all accessible wall receptacles. We look for adverse conditions such as improper installation of aluminum wiring, lack of grounding, overfusing, exposed wiring, open-air wire splices, reversed polarity and defective GFCIs. The hidden nature of the electrical wiring prevents inspection of every length of wire. Telephone, video, audio, security system and other low voltage wiring is not included in this inspection. We recommend you have the seller demonstrate the serviceability of these systems to you.

The following components were inspected:

6.1 ELECTRICAL SYSTEM SPECIFICATIONS

The voltage is 120/240 single phase three wire service. The power is delivered to this building via an underground service lateral. The amperage rating of this service is 100. Copper wire is used for all 120 volt circuits. Aluminum is used for some of the 240 volt circuits. Non-metallic sheathed cable (Romex) is the type of wiring used throughout the house. The grounding of the service is provided by a driven rod.

6.2 UNDERGROUND SERVICE LATERAL

The underground service lateral was not visible for inspection. However, there was 120/240 volt power to the building which suggests that it is functioning as intended.

6.3 SERVICE PANEL LOCATION

The service panel is located in the lower bedroom.

6.4 MAIN DISCONNECT LOCATION

The main disconnect is an integral part of the service panel. The ampacity of the main disconnect is 100 amps.

6.5 SERVICE ENTRANCE CONDUCTORS/CABLES/RACEWAYS

The service entrance conductors are #4 copper and have an ampacity of 100 amps. The service entrance conductors are properly installed and in serviceable condition.

6.6 SERVICE AMPACITY

The capacity of the electrical service is 100 amps. A 100 amp service is adequate for this house with the existing electrical equipment. There is also room to add additional circuits if necessary.

6.7 SERVICE GROUNDING AND BONDING

The service grounding electrode conductor attachment point was not visible for inspection. The adequacy of the service ground was not determined. The evaluation of this connection may require removal of finish materials and is beyond the scope of this inspection.

6.8 SERVICE PANEL

The electrical service panel is properly installed and in serviceable condition except where noted below.

Several of the screws that secure the panel cover to the panel box are stripped. This is a potential hazard. Properly fitted screws with blunt ends should be installed.

6.9 OVER CURRENT PROTECTION

Circuit breakers are used for over current protection. The circuit breakers are properly installed and the ampacity of the connected wires is compatible with that of the circuit breakers. The circuit breakers were not tested.

6.10 WIRING

The visible portions of the wiring are properly installed except where noted below.

Splices in cable made outside of a junction box were observed in the attic. This is a fire hazard. The splices should be made

inside an approved box with a cover.

The wires are not protected where they enter the disposal. This could damage the wires or cause a ground fault. The cord should be clamped and covered in accordance with industry standards.



6.11 RECEPTACLES

All of the readily accessible receptacles were tested. Testing revealed defects requiring repair. These defects are outlined below.

The polarity is reversed in receptacles in the dining area and at the exterior deck. Reversed polarity means that the hot and neutral wires are reversed at the back of the receptacle. This defect is a shock hazard and can damage some electronic equipment. All receptacles exhibiting reversed polarity should be rewired.

There are numerous loose receptacles throughout the home. This is a potential shock and a fire hazard. All loose receptacles should be repaired as necessary.

Cover plates are missing from receptacles in the closet under the stairs and adjacent to the water heating unit. This is a shock and fire hazard. The installation of cover plates on all receptacles is recommended.



6.12 GFCI RECEPTACLES

A ground fault circuit interrupter (GFCI) is a device that detects ground faults (current leakage to ground). It protects you from electrocution. GFCI protection is required for receptacles in bathrooms, kitchens, garages, unfinished basements, crawlspaces and at exterior receptacles.

The installation of additional GFCI protection in the exterior receptacles is recommended.

The installation of just one GFCI outlet for protection of each circuit is recommended.

6.13 AFCI RECEPTACLES

AFCI protection is required for all 15 and 20 amp branch circuits to have protection from the entire branch circuit when that circuit has outlets in dwelling family homes, dining rooms, living rooms, parlors, libraries, dens, bedrooms, sunrooms, recreation rooms, closets, hallways, or similar rooms or areas.

Replacement receptacles are now required to be arc-fault circuit interrupter (AFCI) protected. This means that if you are replacing an old outlet in an old home in a location that needs AFCI protection in a new home, the replacement outlet needs

to be AFCI protected.

6.14 LIGHTS

All of the accessible lights were tested and were found to be functional.

6.15 SWITCHES

All of the accessible switches were tested and were found to be properly wired and functional except where noted below.

The cover plate is missing from the wall switch in the closet under the stairs. This is a shock and fire hazard. The installation of a cover plate is recommended.

HEATING SYSTEM

A natural gas, propane or oil fired furnace or boiler consists of the self contained furnace or boiler, ducts or pipes for heated air or water distribution, thermostats for regulating the amount of heat and a vent system for removing the combustion gases from the building. The readily accessible portions of these items are examined for defects and are tested using normal operator controls. Most heating systems should be serviced annually by a qualified service technician. Failure to perform regular maintenance will affect the reliability of the heating system and will reduce service life.

FORCED AIR HEATING SYSTEM - The following components were inspected:

7.1 GENERAL INFORMATION

Heat is provided by a natural gas fired forced air furnace. The furnace is located in the laundry room. The furnace is approximately 28 years old. The input rating of the furnace is 75,000 BTU. This BTU rating is typical of a home of this size and age.

7.2 GAS PIPING

The gas pipe is properly installed and is performing its intended function.

7.3 AUTOMATIC GAS VALVE

The automatic gas valve or safety valve is designed to prevent the emission of fuel into the furnace if it does not detect heat for ignition. These valves are generally very reliable. The automatic gas valve was functioning as intended.

7.4 IGNITION

The furnace uses an electronic spark ignition. This component was functioning as intended.

7.5 BURNERS

The burners are clogged with debris. This reduces the burner efficiency and produces carbon monoxide. Cleaning the burners is recommended.

7.6 COMBUSTION AIR

The combustion air provides the oxygen for the fuel burning appliances. Combustion air also aids in the movement of combustion gases up the flue. Adequate ventilation around all fuel burning appliances is vital for their safe operation. The air can come from inside the house or from outside providing that the amount of air reaching the appliance is sufficient to maintain efficient combustion and draft. The combustion air supply is adequate.

7.7 HEAT EXCHANGER

The heat exchanger is not visible without disassembling and removing it from the furnace. Cracks typically develop in heat exchangers after 10-20 years. Have your gas furnace technician check the heat exchanger during the next major service.

7.8 VENT

The furnace vent connector is too close to a combustible material. This is a hazard. A minimum clearance of 6" is required between the single wall vent connector and the combustible material. The double wall type B vent requires only 1" of clearance. Repairs are recommended.



7.9 BLOWER

The blower draws air from the return air ducts and pushes it over the heat exchanger where it is heated. The air is then pushed through the distribution ducts into the rooms. The blower was tested and was functioning as intended.

7.10 AIR FILTER

The air filter is located in the return air plenum adjacent to the furnace. The air filter should be cleaned or replaced at least 2-3 times during the heating season.

The air filter is clogged with dust. This reduces air flow and furnace efficiency. Removal and replacement of the air filter is recommended. Pleated style air filters are recommended as they offer better filtration of dust than the coarser hogs hair or fiberglass filters.

7.11 DUCTS

The ducts are constructed out of sheet metal. The ducts are properly installed and are performing their intended function.

7.12 THERMOSTAT

The thermostat is properly installed and the unit responded to the basic controls. This is a programmable device with options for automatic temperature settings (up and down). Testing the automatic operations of this thermostat is beyond the scope of this inspection.

7.13 GENERAL COMMENTS

The furnace's response to the thermostat's call for heat was short cycled. The furnace is in need of repair. The services of a qualified gas furnace technician should be retained to evaluate and repair the furnace.

The furnace is 28 years old and is nearing the end of its service life. The need for furnace replacement should be anticipated.

ON-DEMAND WATER HEATER

The following components were inspected:

8.1 FUEL,CAP,AGE,RECOVERY

The direct vent automatic instantaneous hot water heating unit fuel is natural gas. The input rating of the burner is approximately 150,000 BTU. The recovery rating is 155gph. The water heating unit is approximately 5 years old.

8.2 PRESSURE RELIEF VALVE

The pressure relief valve is properly installed. The valve was not tested, as this could cause the valve to leak.

8.3 SHUTOFF VALVE

The shutoff valve for the water supply to the water heating unit is properly installed and is functioning as intended.

8.4 WATER CONNECTIONS AT UNIT

The water connections at the unit are properly installed and are performing their intended function.

8.5 AUTOMATIC GAS VALVE

The automatic gas valve or safety valve is designed to prevent the emission of fuel into the appliance if it does not detect heat for ignition. These valves are generally very reliable. The automatic gas valve was functioning as intended.

8.6 BURNER

The gas burner is properly installed and is functioning as intended.

8.7 GAS PIPING

The flex connector is properly installed and is performing its intended function.

8.8 VENT

The water heater is a sealed unit that uses a through the wall vent for combustion air and exhausting of combustion gases. The water heater vent is properly installed and is functioning as intended.

8.9 COMBUSTION AIR

The combustion air provides the oxygen for the fuel burning appliances. Combustion air also aids in the movement of combustion gases up the flue. Adequate ventilation around all fuel burning appliances is vital for their safe operation. The air can come from inside the house or from outside providing that the amount of air reaching the appliance is sufficient to maintain efficient combustion and draft. The combustion air supply is adequate.

8.10 GENERAL COMMENTS

The instantaneous on-demand water heating unit is properly installed and is performing its intended function.

KITCHEN

The kitchen was inspected for proper function of components, active leakage, excessive or unusual wear and general state of repair. We inspect built-in appliances using normal operating controls. This includes running the dishwasher, operating the garbage disposal and microwave and checking the burners or heating elements in the stove and oven. Accuracy and/or function of clocks, timers, temperature controls and self cleaning functions on ovens is beyond the scope of our testing procedure. Refrigerators are not tested or inspected unless specifically noted.

The following components were inspected:

9.1 COUNTERTOPS

The countertops are covered with slab crystal granite. The counter tops are properly installed and are in good condition.

9.2 CABINETS

The kitchen cabinets are properly installed and are in good condition.

9.3 FLOORING MATERIAL

The floor is covered with hardwood. The floor is properly installed and is in good condition.

9.4 VENTILATION

The microwave above the stove contains a fan that draws air through a grease filter and then discharges it back into the kitchen. This type of fan is used for filtering grease from smoke generated while cooking foods that contain animal fats or vegetable oil.

9.5 SINK FAUCET

The sink faucet is properly installed and is in good condition.

9.6 SINK

The kitchen sink is properly installed and is in good condition.

9.7 DRAINS, TRAPS AND TRAP ARMS

The sink drain is properly installed and is performing its intended function.

9.8 AIR GAP

The dishwasher drain lacks an air gap. The dishwasher will function without one, but there is a risk of contamination of the inside of the dishwasher by waste water. The installation of an air gap is recommended.



9.9 RANGE

The range was tested and was functioning as intended.

9.10 OVEN

The oven was tested and was functioning as intended.

9.11 MICROWAVE

The microwave oven was tested and was functioning as intended.

9.12 DISHWASHER

The dishwasher was tested and was functioning as intended.

9.13 GARBAGE DISPOSAL

The garbage disposal was tested and was functioning as intended.

The wires are not protected where they enter the disposal. This could damage the wires or cause a ground fault. The cord should be clamped and covered in accordance with industry standards.

9.14 REFRIGERATOR

The refrigerator is functioning as intended.

BATHROOMS

Our inspection of the bathrooms consists of testing of the plumbing fixtures for condition and function. Defects such as leaks, cracked or damaged sinks, tubs and toilets will be listed under the heading of the bathroom in which they were found. The bathroom floor, tub and shower walls are examined for water damage. Ventilation fans are tested for proper operation. Cabinets and countertops are examined for excessive wear and deterioration. Hydromassage tubs are tested and the pump and related equipment are examined when accessible.

BATHROOM

10.1 LOCATION

Hallway.

10.2 BATHTUB

The bathtub is properly installed and is in serviceable condition.

The overflow drain for the bathtub is leaking. This can cause damage to the framing and/or finished surfaces. Repairs should be performed before the tub is used.

10.3 TUB WALLS

The tub walls are properly installed and are in good condition. Most ceramic tile is applied directly over gypsum board rather than on a concrete board such as "Durock" or "Wonder Board". Where the tile is applied directly over the gypsum board, it is critical that the tile grout be maintained to prevent water intrusion behind the tile. Missing or cracked grout should be

repaired. Inside corners, and penetrations in the tile should be kept sealed with a high quality caulk.

Penetrating grout and tile sealers are recommended for preserving the condition of the grout. Grout sealer keeps stains from seeping into and setting in grout. Also, mold and mildew are kept from growing into the grout and the grout stays cleaner for a longer period of time and it will decrease the amount of maintenance that is required to keep it looking good and well maintained. For maximum protection, the sealer should be reapplied at least once.

10.4 FLOORING MATERIAL

The floor is covered with ceramic tile. The tile is properly installed and is in good condition.

The grout is cracked at the intersection between the tub/shower and floor. This can lead to water damage to the flooring and substrate. Caulking this area with a flexible grout is recommended.

10.5 TOILET

The toilet was flushed and was functioning as intended.

10.6 SINK

The bathroom sink is properly installed and is in good condition.

The drain stop is not operational. It should be repaired or replaced.

10.7 DRAINS, TRAPS AND TRAP ARMS

The sink drain is properly installed and is performing its intended function.

10.8 FAUCET FIXTURES

The faucet fixture was tested and was functioning as intended.

10.9 CABINETS

The bathroom cabinet is properly installed and is in good condition.

10.10 COUNTERTOP

The countertop is covered with slab crystal granite. The countertop is properly installed and in good condition.

10.11 VENTILATION

The exhaust fan is very noisy and is not likely to be used in its present condition. We recommend that it be serviced or replaced to restore quiet operation.

10.12 GFCI RECEPTACLES

A ground fault circuit interrupter (GFCI) is a device that detects ground faults (current leakage to ground). It protects you from electrocution. GFCI protection is required for receptacles in bathrooms, kitchens, garages, unfinished basements, crawlspaces and at exterior receptacles. GFCI protected receptacles were found in this bathroom.

BATHROOM

10.13 LOCATION

Lower.

10.14 SHOWER

The one piece fiberglass shower unit is properly installed and in serviceable condition.

10.15 GLASS ENCLOSURE

The glass shower enclosure is labeled as tempered safety glass, is properly installed and in good condition.

10.16 FLOORING MATERIAL

The floor is covered with ceramic tile. The tile is properly installed and is in good condition.

10.17 TOILET

The toilet is loose where it mounts to the floor. A loose toilet will eventually start to leak and will damage the flooring material.. The most reliable fix for this condition is to remove the toilet and install a new wax seal. The toilet should then be securely mounted to the floor.

10.18 SINK

The bathroom sink is properly installed and is in good condition.

10.19 DRAINS, TRAPS AND TRAP ARMS

The sink drain is properly installed and is performing its intended function.

10.20 FAUCET FIXTURES

The faucet fixture was tested and was functioning as intended.

The shower faucet fixture is dripping. This wastes water and will erode the surface of the sink The leaking faucet should be repaired or replaced.

**10.21 CABINETS**

The bathroom cabinet is properly installed and is in good condition.

10.22 COUNTERTOP

The countertop is covered with slab crystal granite. The countertop is properly installed and in good condition.

10.23 VENTILATION

Ventilation in this bathroom is provided by a ceiling fan. This fan was operated and was found to be working satisfactorily.

10.24 GFCI RECEPTACLES

GFCI protected receptacles were found in this bathroom.

LAUNDRY ROOM

Appliances are tested when present and when circumstances allow.

The following components were inspected:

11.1 APPLIANCES

The hookups for the washer are properly installed and in serviceable condition. The washer itself was operated through a partial cycle, however we did not conform the complete operation of the cycle timer.

Upgrading the washer connections to high pressure (steel braided) lines is recommended.

The hookups for the dryer are properly installed and in serviceable condition. The dryer itself was operated through a partial cycle, however we did not confirm the complete operation of the cycle timer.

11.2 DRYER VENT

The visible portions of the dryer vent are properly installed and in serviceable condition. Dryer ducts should be cleaned annually as part of routine home maintenance. A dryer duct that is clogged with lint is a fire hazard.

PLUMBING SYSTEM

A plumbing system consists of the water heater, domestic water supply lines, drain, waste and vent lines and gas lines. Inspection of the plumbing system is limited to the water heater, visible faucets, fixtures, valves, drains, traps, exposed pipes and fittings. These items are examined for proper function, excessive or unusual wear, leakage, and general state of repair. Valves are not tested except where specifically noted. The hidden nature of piping prevents inspection of every pipe and joint. A sewer lateral test, necessary to determine the condition of the underground sewer lines, is beyond the scope of this inspection. If desired, a qualified individual could be retained for such a test. Our review of the plumbing system does not include landscape irrigation systems, off site community water supply systems or private (septic) waste disposal systems. Review of these systems should be performed by qualified and licensed specialists prior to the close of escrow.

The following components were inspected:

12.1 PLUMBING SYSTEM SPECIFICATIONS

The building is on a public water supply system. The building is connected to the municipal sewer system. Copper tubing is used for the water supply piping. ABS plastic is used for the drain, waste and vent pipes.

12.2 MAIN WATER SHUTOFF VALVE

The main water supply shutoff valve is located in the south wall of the lower level. It was tested and was functional.

12.3 MAIN WATER LINE

The main water line is buried underground and was not visible for inspection. The flow indicator on the water meter was checked with all the water shut off in the house. There was no movement of the flow indicator. This suggests that there are no leaks in the main water line. You should check the meter periodically (2-4 times a year) with all the water in the house shut off. Movement of the flow indicator on the meter means that there is a leak either inside the house or in the main line underground.

12.4 INTERIOR WATER SUPPLY PIPES

The visible portions of the copper water supply pipes are properly installed and functional. Copper is considered one of the most desirable materials for interior supply pipes and is expected to last the lifetime of the building.

12.5 WATER PRESSURE

The water pressure at 90 PSI is excessive. The normal range is 40-80 PSI. High water pressure can result in leaking valves, detached supply tubes, water hammer and is hard on solenoid valves. Consideration should be given to the installation of a pressure reduction valve.

12.6 DRAIN AND WASTE PIPES

ABS plastic is used for drain, waste and vent pipes. All of the visible drain pipes were properly installed and functional. ABS is a durable, reliable material and should last the lifetime of the building. All drain, waste and vent pipes were stress tested by filling bathtubs and fixtures to the overflow and then draining them while simultaneously flushing the toilet and running the sinks and showers. No leaks were observed and all fixtures emptied in a reasonable amount of time with no fluctuation in the rate of flow down the drain. This is commonly referred to as "functional drainage".

12.7 SEWER LINE

The main sewer line is buried underground and was not visible for inspection. If you have concerns regarding the condition of the buried waste line(s) the services of a 'sewer line inspection service' is likely to determine the condition of the buried waste lines..

12.8 VENT PIPES

The visible portions of the vent pipes are properly installed and are performing their intended function.

12.9 HOSE BIBBS AND EXTERIOR SUPPLY PIPES

The hose bibbs are the old style that must be protected during freezing weather. This can be accomplished either by installing a foam cap over the bibb or by shutting off the water supply at the indoor gate valve opposite the bibb and then opening the bibb to allow the water to drain out.

12.10 GAS PIPING

The visible portions of the gas piping were properly installed and are performing their intended function. There was no odor of gas leakage at the time of the inspection.

12.11 GAS METER

The gas meter is located on the north side of the building. The main gas shut off valve is installed on the high pressure line emanating out of the ground. This valve requires a wrench to open and close. Keeping a gas valve wrench or adjustable wrench accessible near the gas meter is recommended.

INTERIOR

Our review of the interior includes inspection of walls, ceilings, floors, doors, windows, cabinetry, countertops, steps, stairways, balconies and railings. These features are examined for proper function, excessive wear and general state of repair. In some cases, all or portions of these components may not be visible because of furnishings and personal effects. In such cases these items are not inspected.

The following items were inspected:

13.1 GENERAL COMMENTS

The interior wall, floor, and ceiling surfaces were properly installed and generally in serviceable condition, taking into consideration normal wear and tear.

13.2 FLOORS

The floors squeak in some areas. This is not indicative of a structural defect and in most cases can be eliminated with additional mechanical fastening of the subfloor to the joists. Repairs are easily performed during floor covering replacement.

13.3 STAIRS

The stairs were used several times during the inspection. The stair components are properly installed with exceptions noted below.

There is no handrail in the stairwell. This is a safety hazard. The installation of a graspable handrail that conforms to present industry standards is recommended.



13.4 WALLS AND CEILINGS

There are minor cracks in the walls and/or ceilings. This is a common condition with this type of construction and does not indicate a structural deficiency. The cracks can be repaired or painted over during routine maintenance. Cracks in drywall that have been repaired will often reoccur several months after the repairs have been completed. This is due to seasonal movement of the structure caused by changes in humidity.

13.5 DOORS

All of the doors were tested and were found to be functioning as intended.

Some of the doors are missing their door stops. This condition will lead to damage of the wall surfaces. Door stops should be installed where necessary.

13.6 CLOSET DOORS

All of the closet doors were tested and were found to be functioning as intended.

Hardware is missing from the closet door. Installation of the missing hardware is recommended.

13.7 WINDOWS

The window frames are constructed from PVC and have insulated glass in them. The windows are in good condition and are functioning as intended except where noted below.

There is condensation or mineral deposits between the panes of glass in one of the insulated glass window panes. This indicates a failed seal. The glass assembly should be replaced, which is the only method for correcting this deficiency.



13.8 SMOKE DETECTORS

There is a smoke detector inside each of the bedrooms and in the hallway outside of the bedrooms on the upper and lower floors.

Smoke detectors are examined for location only. They are not tested. Smoke detector batteries should be replaced when you move in and every year thereafter. Once batteries have been replaced, the smoke detectors should be tested for proper operation.

Ionization technology is generally more sensitive than photoelectric technology at detecting small particles, which tend to be produced in greater amounts by flaming fires, which consume combustible materials rapidly and spread quickly. Sources of these fires may include paper burning in a wastebasket or a grease fire in the kitchen.

Photoelectric technology is generally more sensitive than ionization technology at detecting large particles, which tend to be produced in greater amounts by smoldering fires, which may smolder for hours before bursting into flame. Sources of these fires may include cigarettes burning on couches or bedding.

FOR MAXIMUM PROTECTION: Use both Ionization and Photoelectric smoke alarms in every bedroom/hallway on every level of your home.

The installation of at least one carbon monoxide monitor for each floor is recommended. The best place to install the monitor is in an open area near the gas appliance.

13.9 DOOR BELL

The doorbell was functioning as intended.

FIREPLACES, WOOD STOVES AND SPACE HEATERS

The following components were inspected:

14.1 MASONRY FIREPLACES

The visible portion of the masonry fireplace was evaluated. The fireplace is in good condition and no defects or deficiencies were observed.

14.2 DAMPERS

The fireplace damper is functioning as intended. A fireplace damper that is left open when the fireplace is not being used

allows huge quantities of heated air to escape up the chimney. Keeping your fireplace damper closed will result in a significant reduction in heating costs.

14.3 WOOD STOVE INSERT

The visible portions of the wood stove insert are properly installed and are in good condition. The condition of the fireplace in which the insert is placed was not visible for inspection and its condition was not determined. The smoke pipe should extend from the top of the insert, through the smoke chamber and into the flue. This portion of the installation is not visible for inspection. You should have a chimney sweep examine this component when the chimney flue is cleaned.

ENVIRONMENTAL ISSUES

Environmental issues include but are not limited to carbon monoxide, radon, asbestos, lead paint, lead contamination, toxic waste, formaldehyde, electromagnetic radiation, buried fuel oil tanks, ground water contamination and soil contamination. The absence of a statement on any of the environmental issues listed above does not necessarily mean that they are not present. We make reference to these substances only when we recognize them during the normal inspection process. Most of the toxic substances listed above cannot be identified without laboratory testing. If further study or analysis seems prudent, the advice and services of the appropriate specialists are advised.

The following items may exist in this building:

15.1 CARBON MONOXIDE

Many of us encounter CO regularly and never know it because it's invisible and odorless. That's why victims of CO poisoning often have no warning that they are in danger... until it's too late. Symptoms include headache, nausea, chronic fatigue, confusion and dizziness. Extreme exposure can even cause a coma or death.

Carbon monoxide is a product of incomplete (poor) combustion. It's a direct and cumulative poison. When combined with blood hemoglobin, CO replaces oxygen in the blood until it completely overcomes the body. Death from CO occurs suddenly. The victim inhaling the toxic concentration of the gas becomes helpless before realizing that danger exists.

According to the American Society of Heating, Refrigeration and Air Conditioning Engineers (ASHRAE) (Ventilation Standard 62- 89), a concentration of no more than 9 parts per million (ppm) (0.0009%), of CO is permissible in residential living spaces. In addition, the Occupational Safety and Health Administration (OSHA) has set an eight-hour work place maximum of 35 ppm. And in flue gas, the Environmental Protection Agency (EPA) and the American Gas Association (AGA) have established the maximum allowable concentration of CO at 400 ppm (See charts).

To ensure safe and efficient combustion, it is imperative that all gas burning appliances be inspected and serviced regularly (once a year) if used in normal service conditions).

15.2 FORMALDEHYDE

Formaldehyde, a colorless gas with a pungent odor, is so commonly used today that virtually everyone is likely to be exposed to at least small amounts of it, and a significant number of people are developing symptoms due to exposure to large amounts of formaldehyde in their homes or workplaces. It was an integral component of the urea formaldehyde foam insulation (UFFI) that was installed in more than five hundred thousand homes in the 1970's. (The use of formaldehyde in insulation was banned by the Consumer Product Safety Commission in 1982, but this ruling was overturned by a federal court in 1983.) In addition, it is present in a large variety of consumer products. It is a major part of the resins used as glue in particle board, plywood, and other pressed wood products used extensively in the construction of homes and furniture. Some cosmetics, paper towels, upholstery, permanent press fabrics, carpets, milk, toilet seats, pesticides, and explosives contain it too. Formaldehyde is also present in the exhaust from combustion appliances and in tobacco smoke.

The most common symptoms of excessive formaldehyde exposure are burning eyes, itching, shortness of breath, tightness in the chest, coughing, headaches, nausea, and asthma attacks. Large amounts of the gas have produced cancer in laboratory animals, and government policy assumes that any substance that can cause cancer in animals may also cause it in humans.

People who live in homes that have been "tightened" for maximum energy conservation are most likely to suffer from the effects of formaldehyde gas. The formaldehyde gas seeps from the walls, furniture, carpet, etc. into the air, building up to

high levels in the "tightened" home, which can be irritating, particularly to sensitive people.

To minimize your exposure to formaldehyde, ventilate your home - in good weather, open the windows to provide a constant supply of fresh air. Some methods of heat recovery, such as heat recovery ventilators (also known as air-to-air heat exchangers), are available that can ventilate the home while also conserving energy.

You can seal exposed, raw surfaces of particle board and plywood with oil enamel, varnish, wallpaper, or vinyl floor coverings. If you have UFFI insulation, make certain it is completely sealed in the walls or, as a last resort, have it removed.

15.3 LEAD PAINT

Lead paint may be present in or around this house. Lead was used extensively in paint until 1978. Most homes built before 1978 contain some lead paint. Lead paint is a poison. However, the mere presence of lead paint is not necessarily dangerous. Worn, cracked or peeling paint poses the greatest risk. Dust from lead paint is the main cause of lead poisoning in homes. Lead dust is created any time a surface coated with lead paint is exposed to friction - for example when a painted window is repeatedly open and closed or when the surface is sanded prior to repainting or remodeling. The paint dust can be inhaled or swallowed. Paint chips are sometimes ingested by small children. Information on lead paint abatement can be obtained from contractors specializing in lead paint detection and removal.

15.4 ASBESTOS

Asbestos is a naturally occurring mineral fiber that has been used in more than 3,000 different construction materials and manufactured products. It is commonly found in heating system insulation, decorative spray-on ceiling treatments, vinyl flooring, cement shake siding and a variety of additional materials. Some asbestos-containing materials were still being installed into the late 1980s.

The asbestos content of different materials varies according to the product and how it is used. Among those materials with higher concentrations of asbestos are insulating products on heating systems and the backing on sheet vinyl flooring. However, an uncontrolled disturbance of any asbestos-containing material in any concentration may be dangerous to your health!

Why is it a problem? Breathing asbestos fibers could kill you. When disturbed, asbestos breaks down into fibers up to 1,200 times thinner than a human hair. When inhaled, they become trapped in lung tissues. Medical research tells us that up to 30 years after inhalation, asbestos fibers can cause lung cancer or mesothelioma, a related terminal cancer of the tissue lining the chest cavity.

Because asbestos is a naturally occurring mineral and has been so widely used in manufactured products, including automobile brake linings, it can be found almost everywhere. Trace amounts are in the air we breathe every day. Most of us have asbestos fibers in our lungs.

On the other hand, there's no known safe level of asbestos exposure. That's why medical, environmental health and regulatory organizations stress the need to protect health by minimizing exposure to airborne asbestos fibers. This is particularly true when asbestos fibers accumulate at elevated levels. Elevated levels result from uncontrolled disturbances and removal of asbestos-containing materials.

How do I know if it's asbestos? Don't guess! Look for asbestos markings on the product or track the product back to its manufacturer or supplier. If these approaches don't work, submit a small sample for laboratory analysis. Cost is minimal. Laboratories are listed in the yellow pages under "Asbestos - Consulting and Testing." Ask a laboratory technician to instruct you how to safely take a sample. If you decide not to check for asbestos in a suspected material, you should assume it contains asbestos and treat it accordingly.

INSULATION

Insulation, weatherstripping, dampers, storm windows, insulated glass and set-back thermostats are features that help reduce heat loss and increase the comfort and thermal efficiency of your home. We examine these items and identify approximate R values for insulation. When appropriate, we offer suggestions for upgrading. Our review of insulation is based upon a random sampling of accessible areas and does not constitute a warranty that all such areas are uniformly insulated or are insulated to current standards.

The following items were inspected:

16.1 ATTIC INSULATION

The attic is insulated with blown in cellulose insulation. The approximate R value of this insulation is 9. This provides only minimal resistance to heat transfer. Adding additional insulation to achieve an R value of 30 is recommended to reduce heat loss through the ceilings.

16.2 WALL INSULATION

The exterior walls are not insulated. The installation of wall insulation can be accomplished by boring 2" holes in the drywall or plaster and injecting cellulose into the wall cavity.

STRUCTURE

The structural elements of most residential buildings include a foundation, footings, floor, wall, ceiling and roof framing. The visible portions of these items are examined for proper function, wear, deterioration or signs of non-performance. Some structural components or portions of them are inaccessible because they are buried below grade or hidden behind finished surfaces. Therefore, much of the structural inspection is performed by identifying resultant symptoms of movement, damage and deterioration. Where there are no visible symptoms, components or conditions requiring repair may go undetected and identification will not be possible. We make no representations as to the internal conditions or stabilities of soils, concrete footings and foundations, except as exhibited by their performance.

The following components were inspected:

17.1 GENERAL INFORMATION

The foundation is constructed from poured in place concrete. A perimeter foundation wall supports the exterior walls of the building. Interior load bearing components are supported by pier footings and/or continuous spread footings. The floor structure is constructed out of wood joists. The subflooring is plywood. The stud walls are constructed from 2 X 4 dimensional lumber. The exterior wall sheathing is plywood. The roof structure is conventionally framed out of dimensional lumber. The roof sheathing is plywood.

17.2 FOUNDATION

The foundation is constructed in a manner typical of buildings of this type and age. There are minor shrinkage cracks in the foundation. Shrinkage cracks are common in poured concrete foundation walls. They do not affect the performance of the foundation. No action is indicated.

17.3 MUDDSILL

The mudsill is typically a 2x4 or 2x6 member that is laid flat directly on the top of or cast into the top of the foundation wall. The mudsill is usually bolted to the foundation wall and serves as a base for the rest of the floor framing. In this building, the mudsill is inaccessible and cannot be evaluated. There was no evidence present that would suggest that there are defects in this component.

17.4 ANCHOR BOLTS

Anchor bolts are bolts that are cast into the top of the concrete foundation and retain the mudsill. Anchor bolts primary function in this area, is to prevent the building from being displaced from its foundation during an earthquake. Anchor bolts have grown in diameter over the years as have the nuts and washers that retain the mudsill. Generally speaking, the newer the building, the better resistance it will have to seismic activity. Due to the design of this building, anchor bolts are not visible and could not be evaluated.

17.5 FLOOR JOISTS

The floor joists are covered with finished surfaces and therefore were not visible for inspection. There was no evidence present suggesting that defects or deficiencies are present.

17.6 SUBFLOORING

The subfloor was covered with insulation and finished surfaces and was not visible for inspection. There was no evidence present suggesting that defects or deficiencies are present.

17.7 WALLS

The walls are covered with finished surfaces and therefore were not visible for inspection. No evidence of defects or deficiencies was observed.

17.8 ROOF STRUCTURE

The roof structure is constructed from site cut and assembled dimensional lumber. The roof structure is constructed in a manner consistent with buildings of this type and is performing its intended function. No defects or deficiencies were observed.

17.9 ROOF SHEATHING

The roof sheathing is installed in a manner consistent with buildings of this type and is performing its intended function. No defects or deficiencies were observed.

17.10 CARPORT

The carport is a wood frame structure built on concrete pier footings. The carport roof structure is constructed in a manner typical of carports of this type and age. No major defects or deficiencies were observed and the carport is performing its intended function.

BASEMENT

Basements are portions of the house that are below grade. Any below grade portion of the house is vulnerable to water intrusion. Water intrusion can take the form of water migrating up through the floor or foundation wall, or dampness which usually manifests in mold/mildew and/or efflorescence on the foundation walls and/or floor. Water intrusion is often seasonal and in many cases only occurs during periods of extensive rainfall. The basement often contains major components of the structure, plumbing, heating and electrical systems. These components are discussed under their respective headings.

The following observations were made in the basement:

18.1 MOISTURE

A sump pump has been installed to remove incoming ground water. The sump pump was tested and was operational.



Southeast corner

OUT BUILDING

OUT BUILDING - The following components were inspected:

19.1 OUTBUILDING WALLS

The bottom of the outbuilding walls are rotted where they have had chronic contact with moisture. Rot damaged material should be repaired and protected from chronic contact with moisture.

